

Required Materials:

Windows host computer (Windows 7/10)

USB cable (Type A to Type B)


Setup_TP_Param_Update_K2_v1002a.zip

Firmware file according to below table:


IDS Model	Firmware File	Description
3202L	SW602603	PCAP CONFIGURATION FILE, CTR-8301, ET3202L, TOUCH-THRU MODE
4202L	SW602592	PCAP CONFIGURATION FILE, CTR-8301, CTR FW V1.32, ET4202L WITH 6mm COVER GLASS
4602L	SW602591	PCAP CONFIGURATION FILE, CTR-8301, CTR FW V1.32, ET4602L WITH 6mm COVER GLASS
5502L	SW602590	PCAP CONFIGURATION FILE, CTR-8301, CTR FW V1.32, ET5502L WITH 6mm COVER GLASS
3243L	SW602604	PCAP CONFIGURATION FILE, CTR-8301, ET3243L, TOUCH-THRU MODE
4343L	SW602605	PCAP CONFIGURATION FILE, CTR-8301, ET4343L, TOUCH-THRU MODE
5543L	SW602593	PCAP CONFIGURATION FILE, CTR-8301, CTR FW V1.32, ET5543L WITH 6mm COVER GLASS

Steps for updating the Touch Through firmware on IDS:


1. Download the "setup_TP_Param_Update_K2_v1002a.zip" file and extract the .exe file.
2. Run the "setup_TP_Param_Update_K2_v1002a.exe" file.
3. Follow through the installation process.

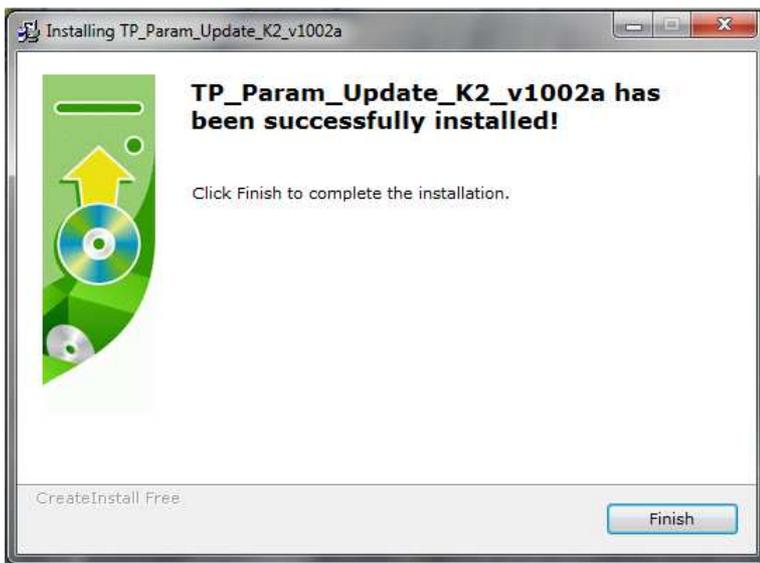


4. Place the .BIN file into the "C:\TP_Param_Update_K2\writeFile\Param" folder.

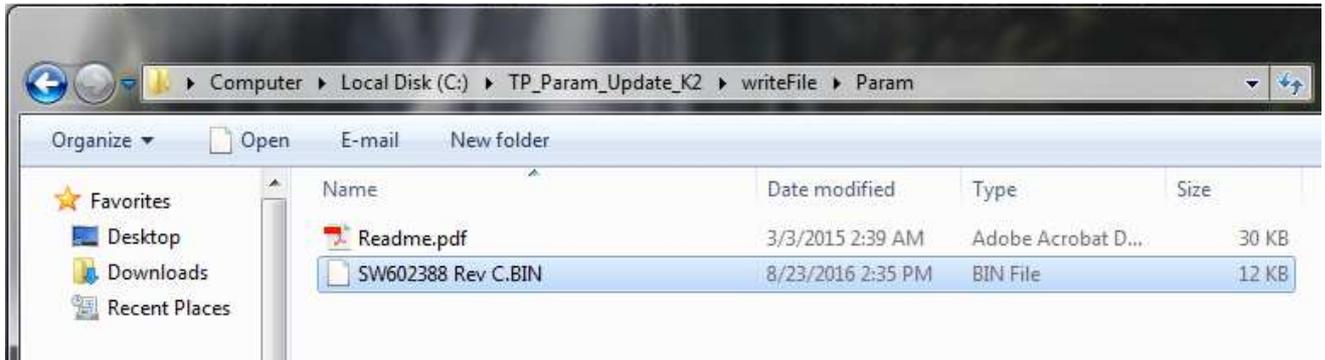


5. Double click on the “TP_Param_Update_K2a.exe” file in the “C:\TP_Param_Update_K2” folder.

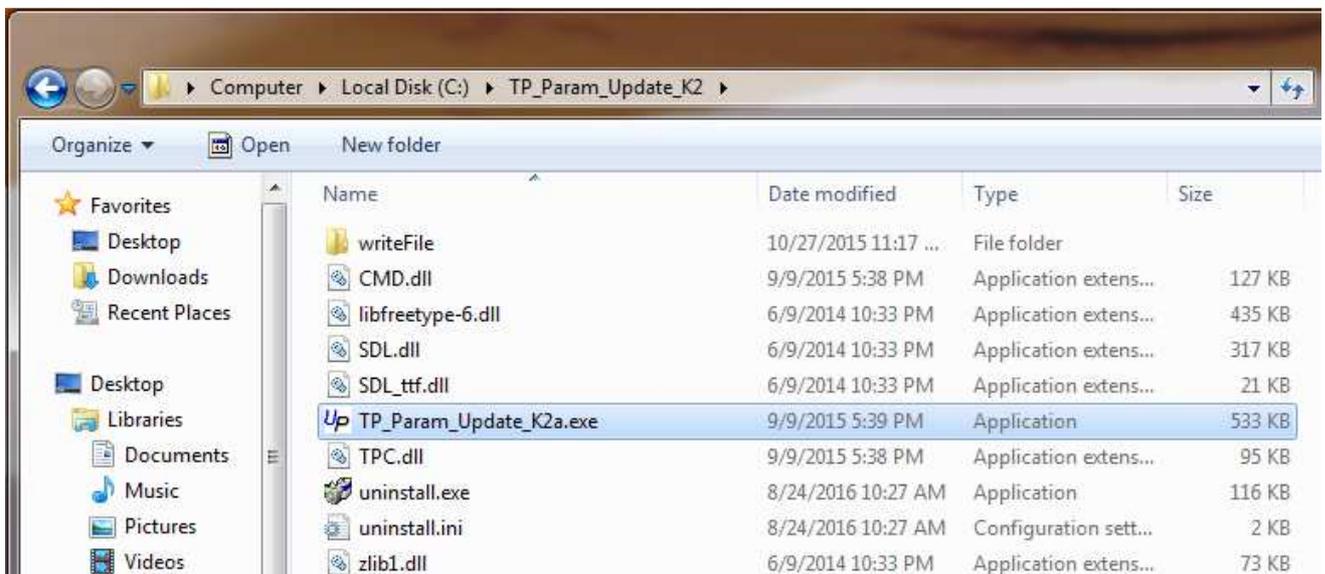


6. Once the tool opens, click on the Setup tab and select “USB Device”.

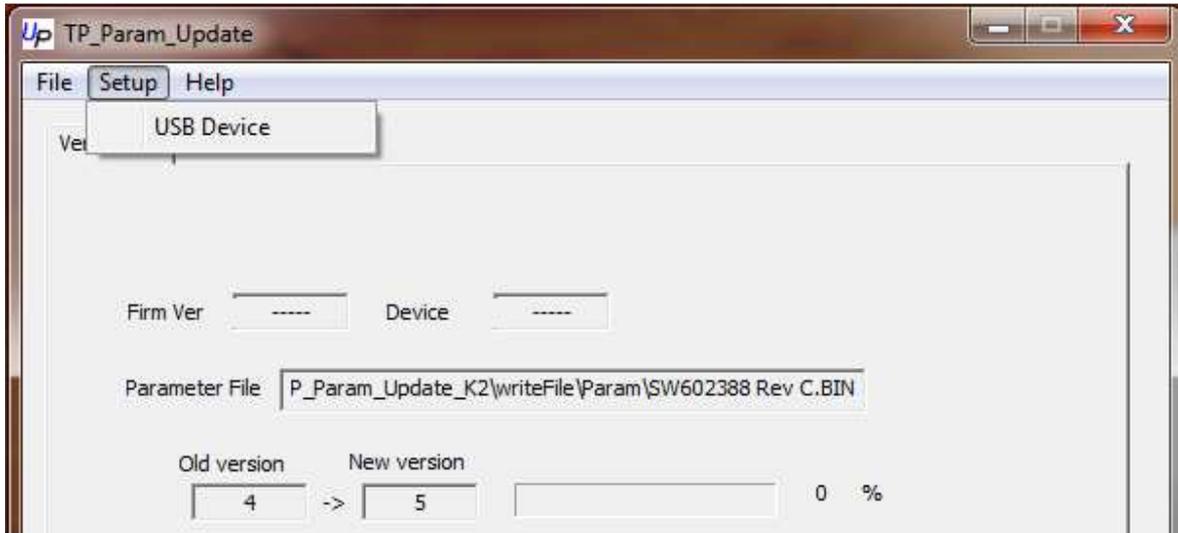

7. Select "VendorID=04E7 / ProductID=240C" in the dropdown menu

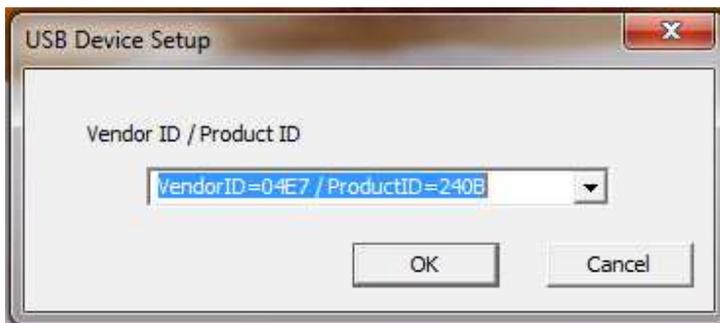

8. Click on the "Start" button to start the update process.

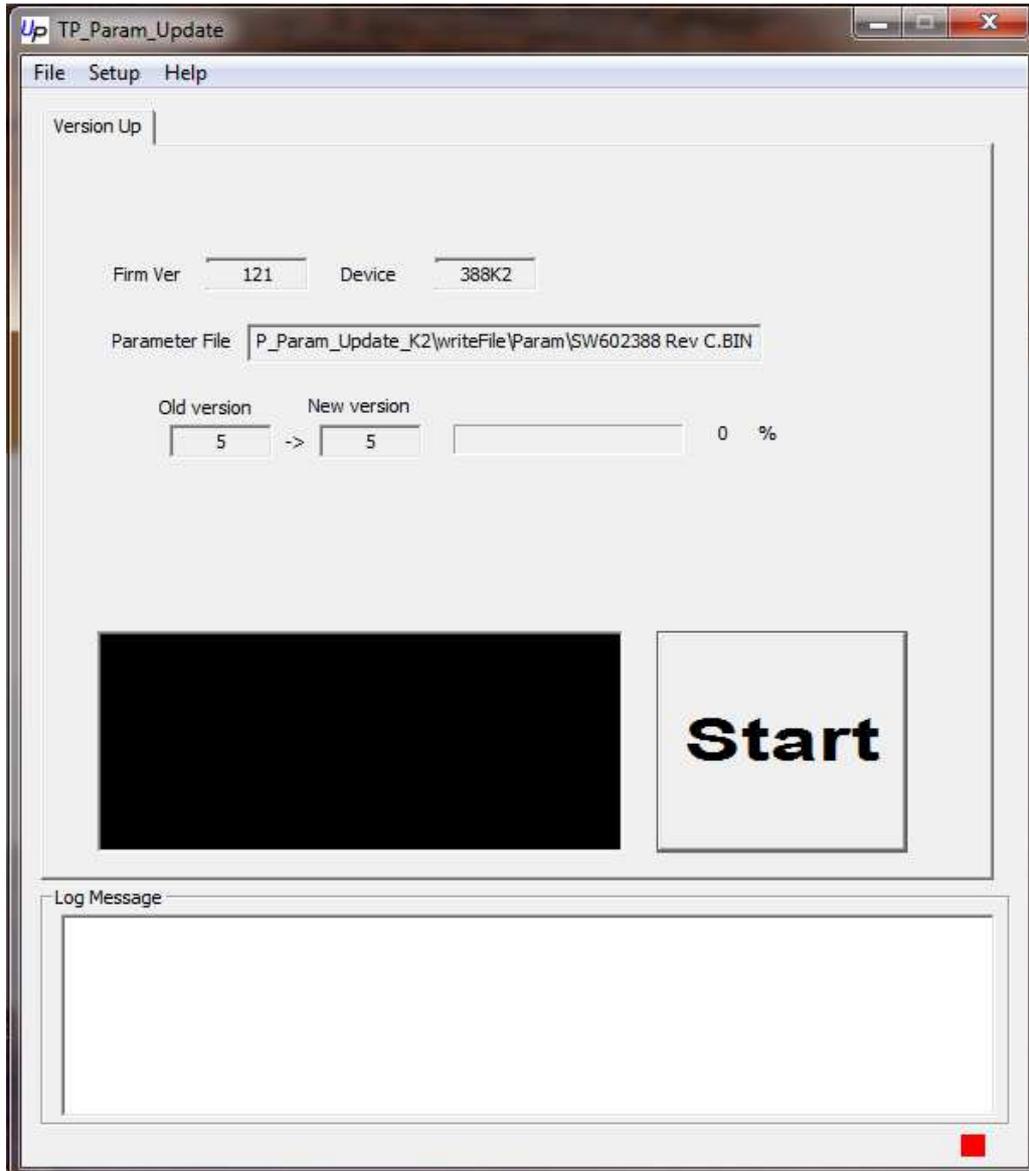

9. After the update process is complete you should see the screen below.

